



## 30' Front Wing Swivels

Page 1 of 1

For Models- 30'

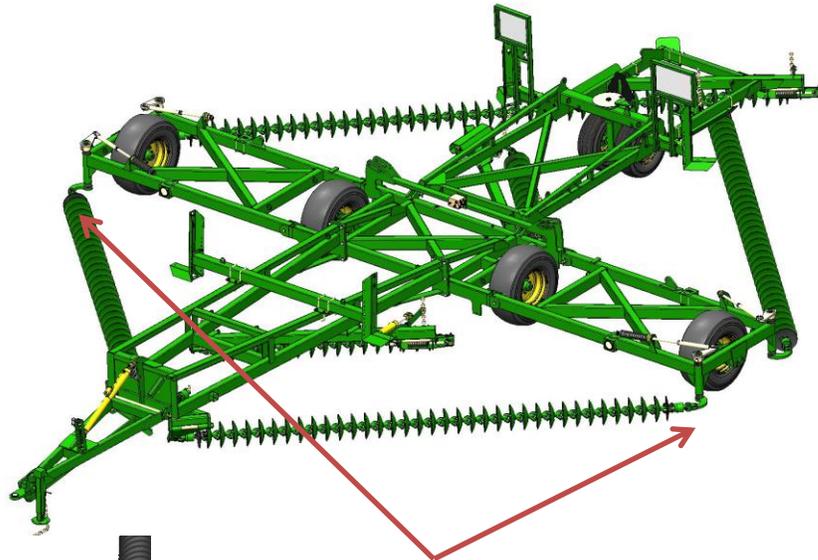

Swivels Affected

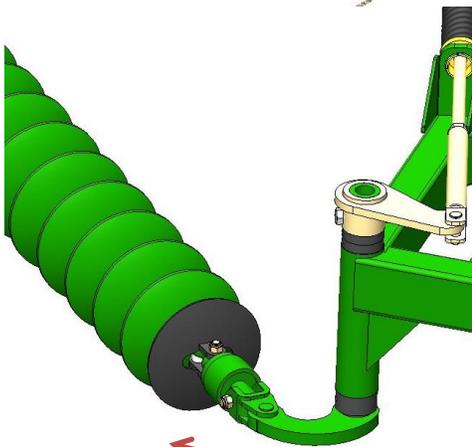

Direction of travel

It has come to our attention that 30' machines, when stored outside and exposed to rain and snow, may have bearings which become waterlogged and fail prematurely (the swivels affected are shown above). If the machine is likely to be left exposed to these conditions it is recommended that the bearing be removed, and replaced with the seal facing downwards whilst in the transport position, similar to the opposite swivel on the outer wing. This will prevent water ingress during storage and thus extend the life of the swivel.

Swivels Affected

